

# The X30 Official Firmware Release Note ( R0147 )

- ① Release date : November 12th, 2018
- ② The version of updated firmware : R0147
- ③ Refer to the below for the contents updated from R0135 to R0147

## ※ Important NOTICE

From X30\_R0147 new firmware, Reciva Internet Radio is no more available at X30 device. Instead of Reciva Internet Radio, please use Airable Internet Radio which is far better than Reciva. As Reciva doesn't do internet radio business, so thier server has never updated recently. This makes Reciva Internet Radio work abnormally at X30 device. This is why we removed it from our device, and for this, we arranged alternative internet radio, Airable at X30 device long time ago.

## A. New Functions

### 1 Improvement of MusicDB structure

We improved MusicDB structure to handle better multi-album, 'Best of ' and not to change original song tag file when importing to DB. **Album name repetition is allowed.**

#### ※ NOTICE

Your device may not work properly If you go back to previous firmware after updating your device with this new firmware, because MusicDB structure was quite changed

#### 1-1) In importing at Browse mode

- . Basic concept : To make always new Album
- . If upper folder is same and Album names are same, they will be imported to same album just like multi-album if you select 'No' when questioned "Do you want to use folder name as album name?"

#### 1-2) in CD Ripping

- . Basic concept : To make always new Album
- . CDs of same album name but different artist(different CD) will be ripped to different folders(albums)
- . Multi CDs will be ripped to one folder(albums)

#### 1-3) in merging Albums

You can merge albums to one folder by using 'Album Help' function like below

continued

1-3-1) In case that you don't change anything for album name after selecting one album from 'Album Help' list, the album will merge into same album(folder)



For example, you want to merge 'Essential Best' album to 'Diva - The Single Collection'



① Place cursor on the target album(Essential Best), and press MENU and confirm 'File Operation'



② Select 'Album Edit', then 'More Info for Multi-Album' screen will show up. Press OK key to go to Album Help screen




③ Select 'Album Edit', then 'More Info for Multi-Album' screen will show up. Press OK key to go to Album Help screen

④ Select 'Diva - The Single Collection'



⑤ 'Diva - The Single Collection' album is inserted to Album name position properly.

⑥ Select OK icon and confirm it

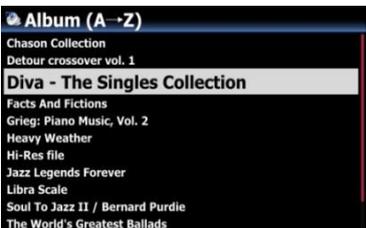

⑦ You see two albums merged



1-3-2) In case that you changes something for album name after selecting one album from

'Album Help' list, new album will be created, instead of merging to same album(folder)

continued

2

### 1-4) MusicDB Recovery


As we added some solution to remove 'the attached /artist name after album name' and change it to original tag. Please run 'MusicDB Recovery' at SETUP

### 1-5) Added option to show '/artist name after album name' at SETUP




You can display Album name only or Album name / Artist name on the Album View.

※ Default : ON

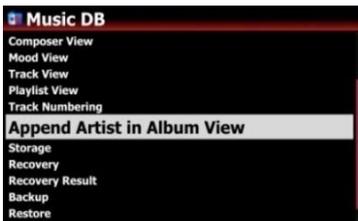

## 2 CD Ripping Program Restructuring and Algorithm improvement

We restructured and far improved our software algorithm and code related to CD ripping. We are sure that the improved software(firmware) offers very high quality of CD ripping result as it checks data density of each track and manages CD Ripping Speed, and error by itself

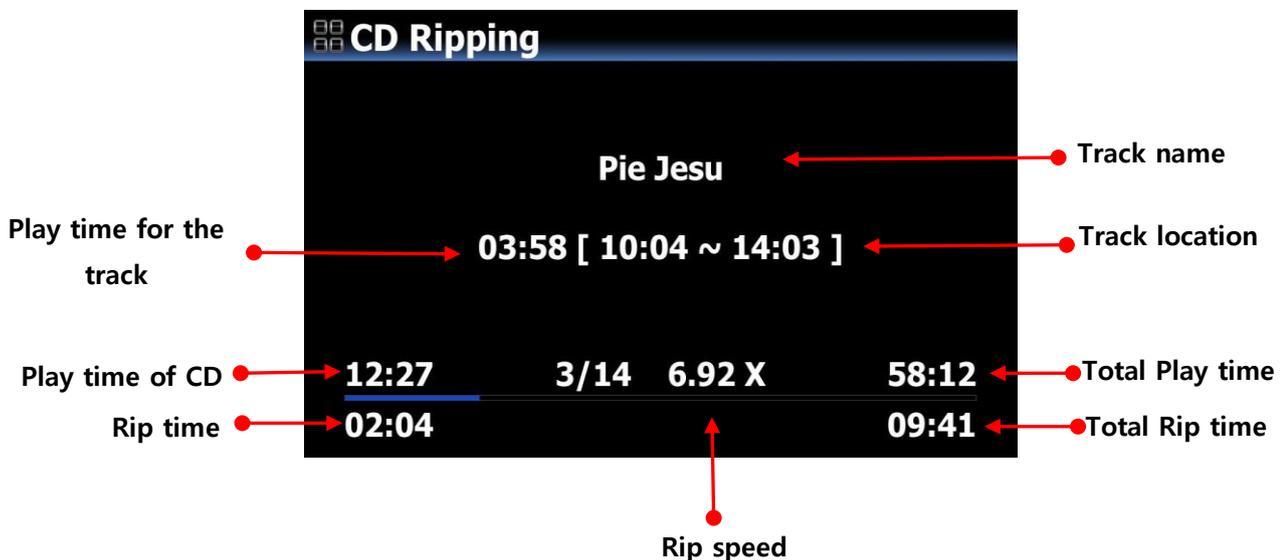

### 3 To edit Genre, Mood and Temp

You can access to Genre, Mood and Temp on the info window when CD ripping. Typed info for them of the track 1 will be applied to next tracks in case that each area has no data

*continued*

3

### 4 User option for loading track number in the Qobuz

It used to load 50 songs only when start playing track in the Qobuz. We added User Option at SETUP, so that users could set track number to be loaded like below.



## B. Improvement

- 1 Cleared the bug that X30 doesn't boot up properly and stay in 'Glass Initializing' status in case that a certain 4TB HDD is installed, and network(WiFi dongle or Ethernet) is not connected(inserted)
- 2 Cleared the bug that 1~2 seconds are missing when recording to external USB storage via X30 Analog In
- 3 Improved the bug that Wired network is disconnected by itself when X30 is first connected to WiFi, and connected to Wired, and then USB dongle is removed.
- 4 Improved to clear Shared Folders added to NET after Factory Reset
- 5 Improved not to display 'mouse pointer' even if an USB mouse or USB keyboard which has mouse function is connected
- 6 Improved to show Left/Right text for two lines of input level graphics for Digital or Analog Input
- 7 Improved to show sample rate(48/96/192Khz) as well as file formats in playing files via online services
- 8 Cleared the bug that some noises come out in playing other file formats after playing APE file
- 9 Cleared the bug that album cover searching function for Qobuz doesn't work properly on WebInterface
- 10 Improved other code more to make X30 device more stable
- 11 For security issue, we have recently updated our server system. Accordingly, code related to Gracenote License management and Firmware Release management was updated
- 12 'Path' is added on dialog window for 'Add Share' function on Browser



You can easily search the shared folder of the NAS connected to X30 with IP address. If IP address is not listed in the 'Path' when you selected 'Server', you can insert IP address of the NAS manually with connected USB keyboard. Then, place the cursor on the IP address and click it to get the shared folder easily.

**13 On Album Help Window, the color of original Album name will be changed to blue**



When you merge Multi albums using 'Album help' function, the color of original album name on the Album Help window will be changed to blue, not to make you confused between original album and target album

**14 Improved 'Max volume' function of MusicX App to work properly**

**15 Cleared the bug that X30 device is frozen if you try editing the cover art with MusicX App**

**Thank you very much!**